

Service Parts Information

HIGH TORQUE LOW SPEED VANE MOTORS


MODEL	SHAFT	SNAP RING (2 REQ'D)	KEY	BEARING (2 REQ'D)	RING "A"	RING "B"	RING "C"	PLUG
MHT-570/285/285-*1-30					364468	364468	364468	
MHT-690/375/315-*1-30	389208	354386	332265	310539	343826	375223	375223	7074
MHT-750/375/375-*1-30						343826	343826	

▲ INCLUDED IN SEAL KIT 919883


F3 EQUIVALENT SEAL KIT 919884

SLEEVES MUST BE .002 BELOW FACE .006 OF BODY.

WHEN ASSEMBLING A MHT-690/375/315, THIS .25 DIA. HOLE IN ONE SIDE OF 375223 RING MUST FACE THE DOUBLE PORT BODY 397231.

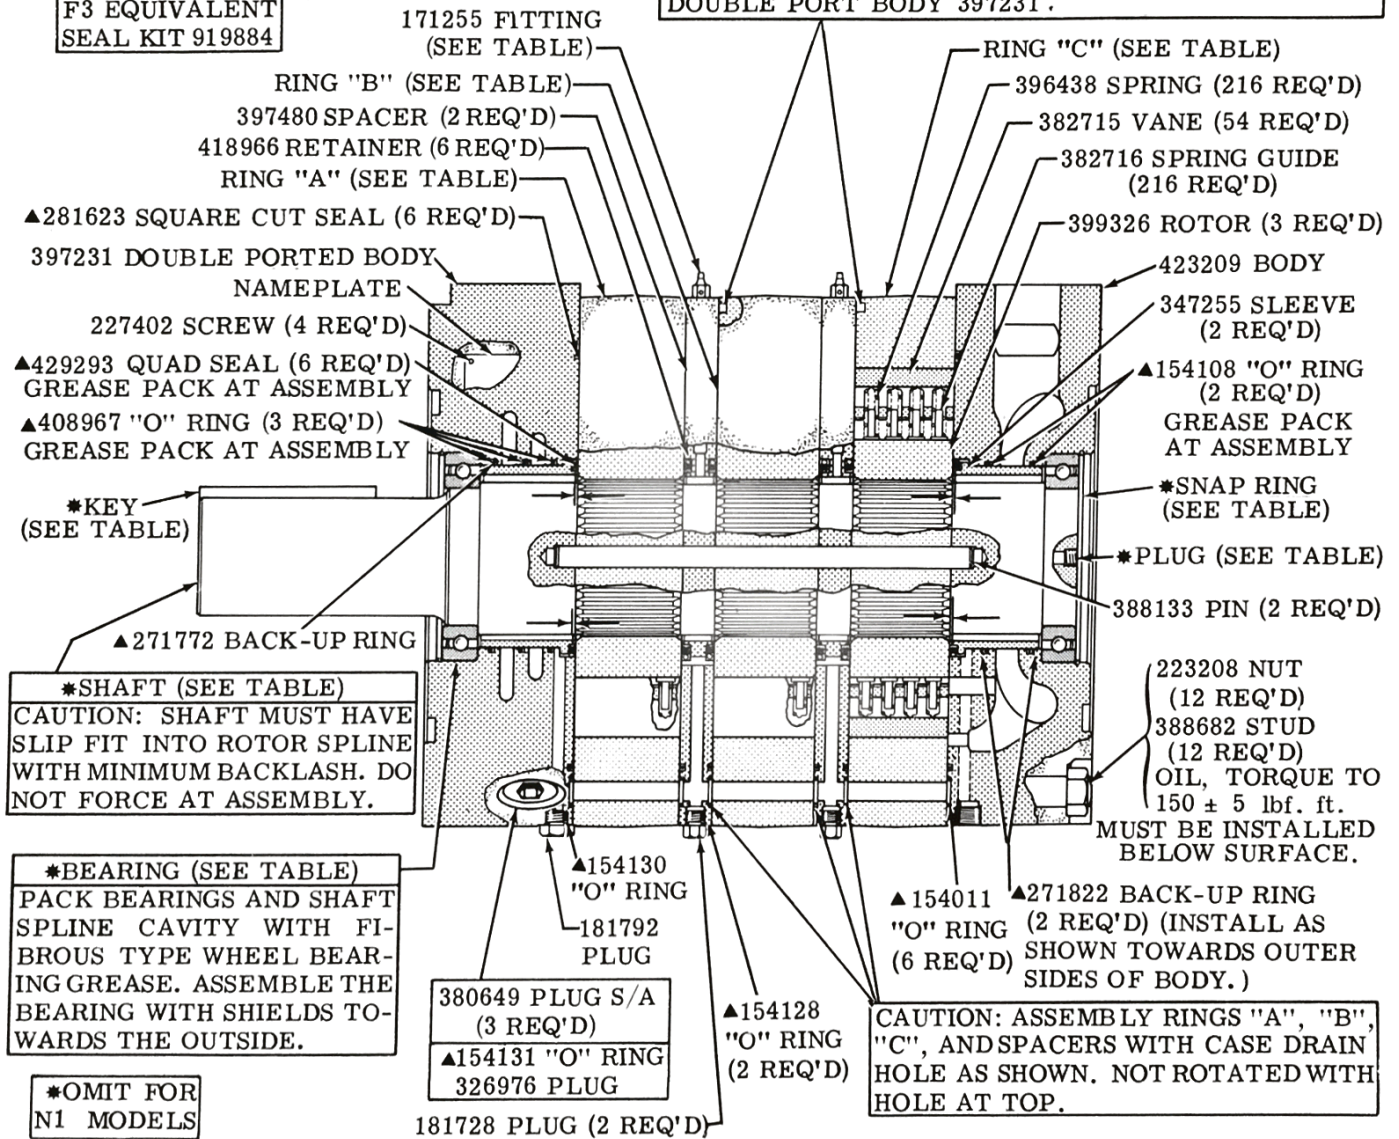

MODEL CODE BREAKDOWN

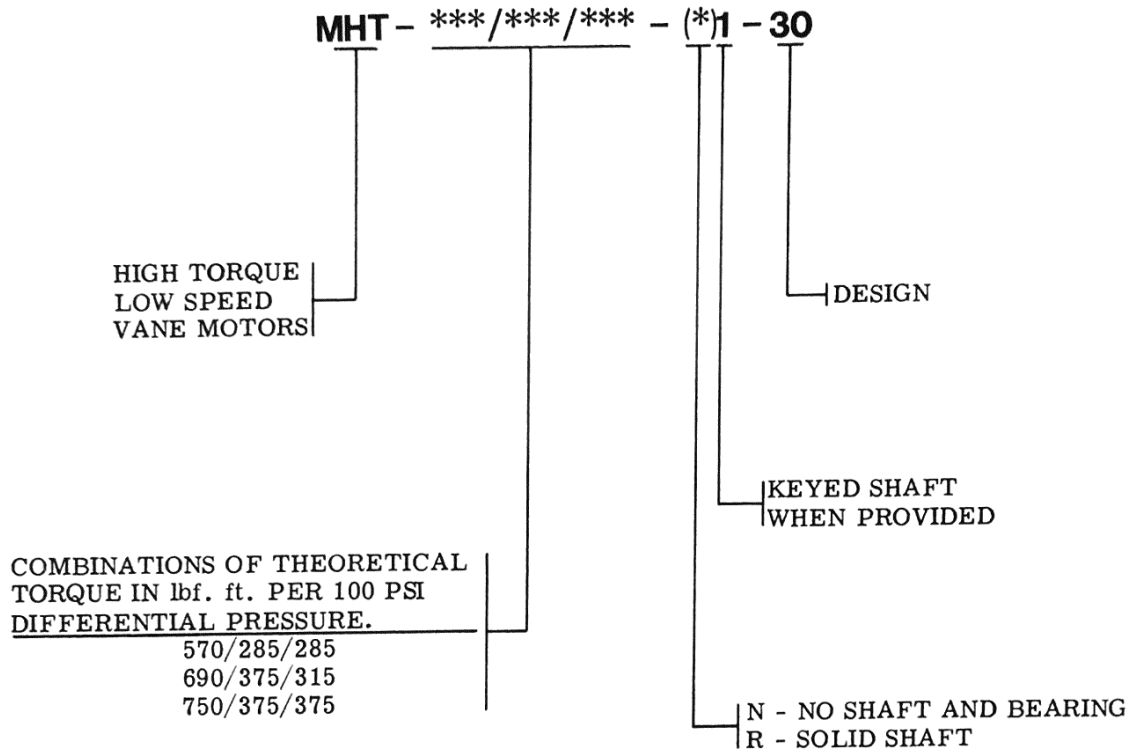

To insure sustained efficiency and maximum trouble-free life of this precision equipment, initial and continuous filtration of the fluid medium to 25 microns absolute or less is essential. (For information pertaining to Sperry Vickers economical 3 or 10 micron filters, see installation drawing 522140.)